

Notes to:

B. Rosebrook

11-15-95

TWO-LANE RESURFACING PROGRAM

FY 1996

PERSONNEL Van Dusen

Moser

Huss

PRIORITY NO. 25 PART 1 OF 1 SHEET 1 OF 13COUNTY Lucas ROUTE US 24 SECTION 5.61BEGIN LOG (SLM) 5.61 TERMINII Const joint (near Box Rd)END LOG (SLM) 10.73 TERMINII Const joint (near SR 64)TOTAL LENGTH 5.12 MILESMUNICIPALITY Waterville BEGIN LOG (SLM) _____ END LOG (SLM) _____

MUNICIPALITY _____ BEGIN LOG (SLM) _____ END LOG (SLM) _____

PROPOSED WORK: ResurfacePAVEMENT 1 3/4" 402 & 1 1/4" 404 SHOULDER SAME - 617OTHER locate for bad pavement areasSTATION ESTABLISHED FROM: PK. NAIL @ BOX ROADSTA. 296+04REF. No 30
10-11-94

STRUCTURES:

NUMBER	STATION	WIDTH	LENGTH	PROPOSED WORK

RAILROAD CROSSING:

(NO WORK)

NAME _____ STATION _____ NO. TRACKS _____ LENGTH ALONG C L _____ FT

NAME _____ STATION _____ NO. TRACKS _____ LENGTH ALONG C L _____ FT

MISCELLANEOUS:

NO RAISED PAVEMENT MARKERS; EDGE OF PAVEMENT 0- CENTERLINE 185NO. MAILBOX APPROACHES N/A MAILBOX SUPPORTS N/AREMARKS: CONST. JOINT = 296+09CONST. JOINT = 547+25

DATE 11-07-93

TWO-LANE RESURFACING PROGRAM
DEFECTIVE PAVEMENT AREAS

SHEET 2 OF 13

COUNTY Lucas ROUTE U.S. -24 SECTION 5.61

[illegible]

DATE 11-07-95TWO-LANE RESURFACING PROGRAM
DEFECTIVE PAVEMENT AREASSHEET 1 OF 13COUNTY LUCAS ROUTE U.S. 24 SECTION 5.61

STATION		LT BERM	LT LANE	RT LANE	RT BERM	SIZE (WIDTH)	EXISTING PAVEMENT CONDITIONS		
FROM	TO						RUTTED	CRACKED	BASE FAILURE
346+00	352+55				X	3'		X	(Some areas pavt. is broken off)
357+20	357+90				X	3'		X	(Some areas pavt. is broken off)
361+00	363+60				X	3'		X	
373+10	373+60			X		3'	X	X	along white line
438+55	439+90				X	3'		X	(broken off)
438+75	439+80			X		6'		X	
442+00	444+00				X	3'		X	(broken up)
452+75	456+20				X	2'		X	(outside 2' of the berm broke up)
459+80	461+00				X	2'		X	(outside 2' of the berm broke up)
464+00	470+00				X	2'		X	(outside 2' of the berm broke up)
470+76	471+50				X	2'		X	(outside 2' of the berm broke up)
474+00	475+60				X	1'		X	(outside 1' of the berm broke up)
488+75	490+00			X		3'	X	X	(outside 3' next to white line)
497+30	498+00				X	2'		X	(outside 2' of berm)
499+20	502+30				X	2'		X	(outside 2' of the berm broke up)
502+07	502+25			X		12'	X	X	(top course cracked up)
506+40	508+00		X	X		2'		X	(top course cracked up along centerline)
520+76	522+60				X	2'		X	(outside 2' of berm broke up)
524+18	524+30				X	3'			hole in the berm
559+50	564+00	X				1'		X	(outside 1' of berm broke up)
552+20	558+10	X				1'		X	
552+44	552+88		X			2'		X	(outside 2' next to white line)
553+10	557+90		X			2'		X	(outside 2' next to white line)
548+65	550+78		X			2'		X	(outside 2' next to white line)
543+50	548+65		X			12'	X	X	(surface course cracked & rutted)
539+30	543+50		X			3'	X	X	(outside 3' next to white line)
528+30	536+70	X	X			4.5'	X	X	(outside 3' including berm - cracked up)

SHEET 3 OF 13

SHEET 3 OF 13

SHEET 3 OF 13

SHEET 3 OF 13

[illegible]

SHEET 4 OF 13

COUNTY Lucas ROUTE 24 SECTION 5.61

[illegible]

SHEET 5 OF 13

SHEET 5 OF 13

L = PROP PAVT DEPTH (IN.) $\times 10$; W = WIDTH @ MOUTH; $W-I$ = WIDTH @ THROAT

[illegible]

DATE 11-09-75

TWO-LANE RESURFACING PROGRAM
CROSSWALKS AND STOP BARS

SHEET 6 OF 13

COUNTY Lucas ROUTE 24 SECTION 5.61

[illegible]

11-04-72

SHEET 7 OF 13

UTILITIES (CATCH BASIN, MANHOLE, INLET, WATER VALVE, BOX AND MONUMENT BOX)

COUNTY Lucas ROUTE 24 SECTION 5.61


R = RAISE F = FEATHER

[illegible]

Curb St 518+34

PERSONNEL	TITLE	PERSONNEL	TITLE	COUNTY	DATE	WEATHER	TEMP.
VAN DUSEN				LUCAS	11-9-95	CLEAR	+35°F
MOSEY				S. R. U.S. 24			
HUSS				SEC. 5.61			

DESCRIPTION	PAVEMENT	DETAIL	JOB NO.
LEFT		CENTER LINE	RIGHT

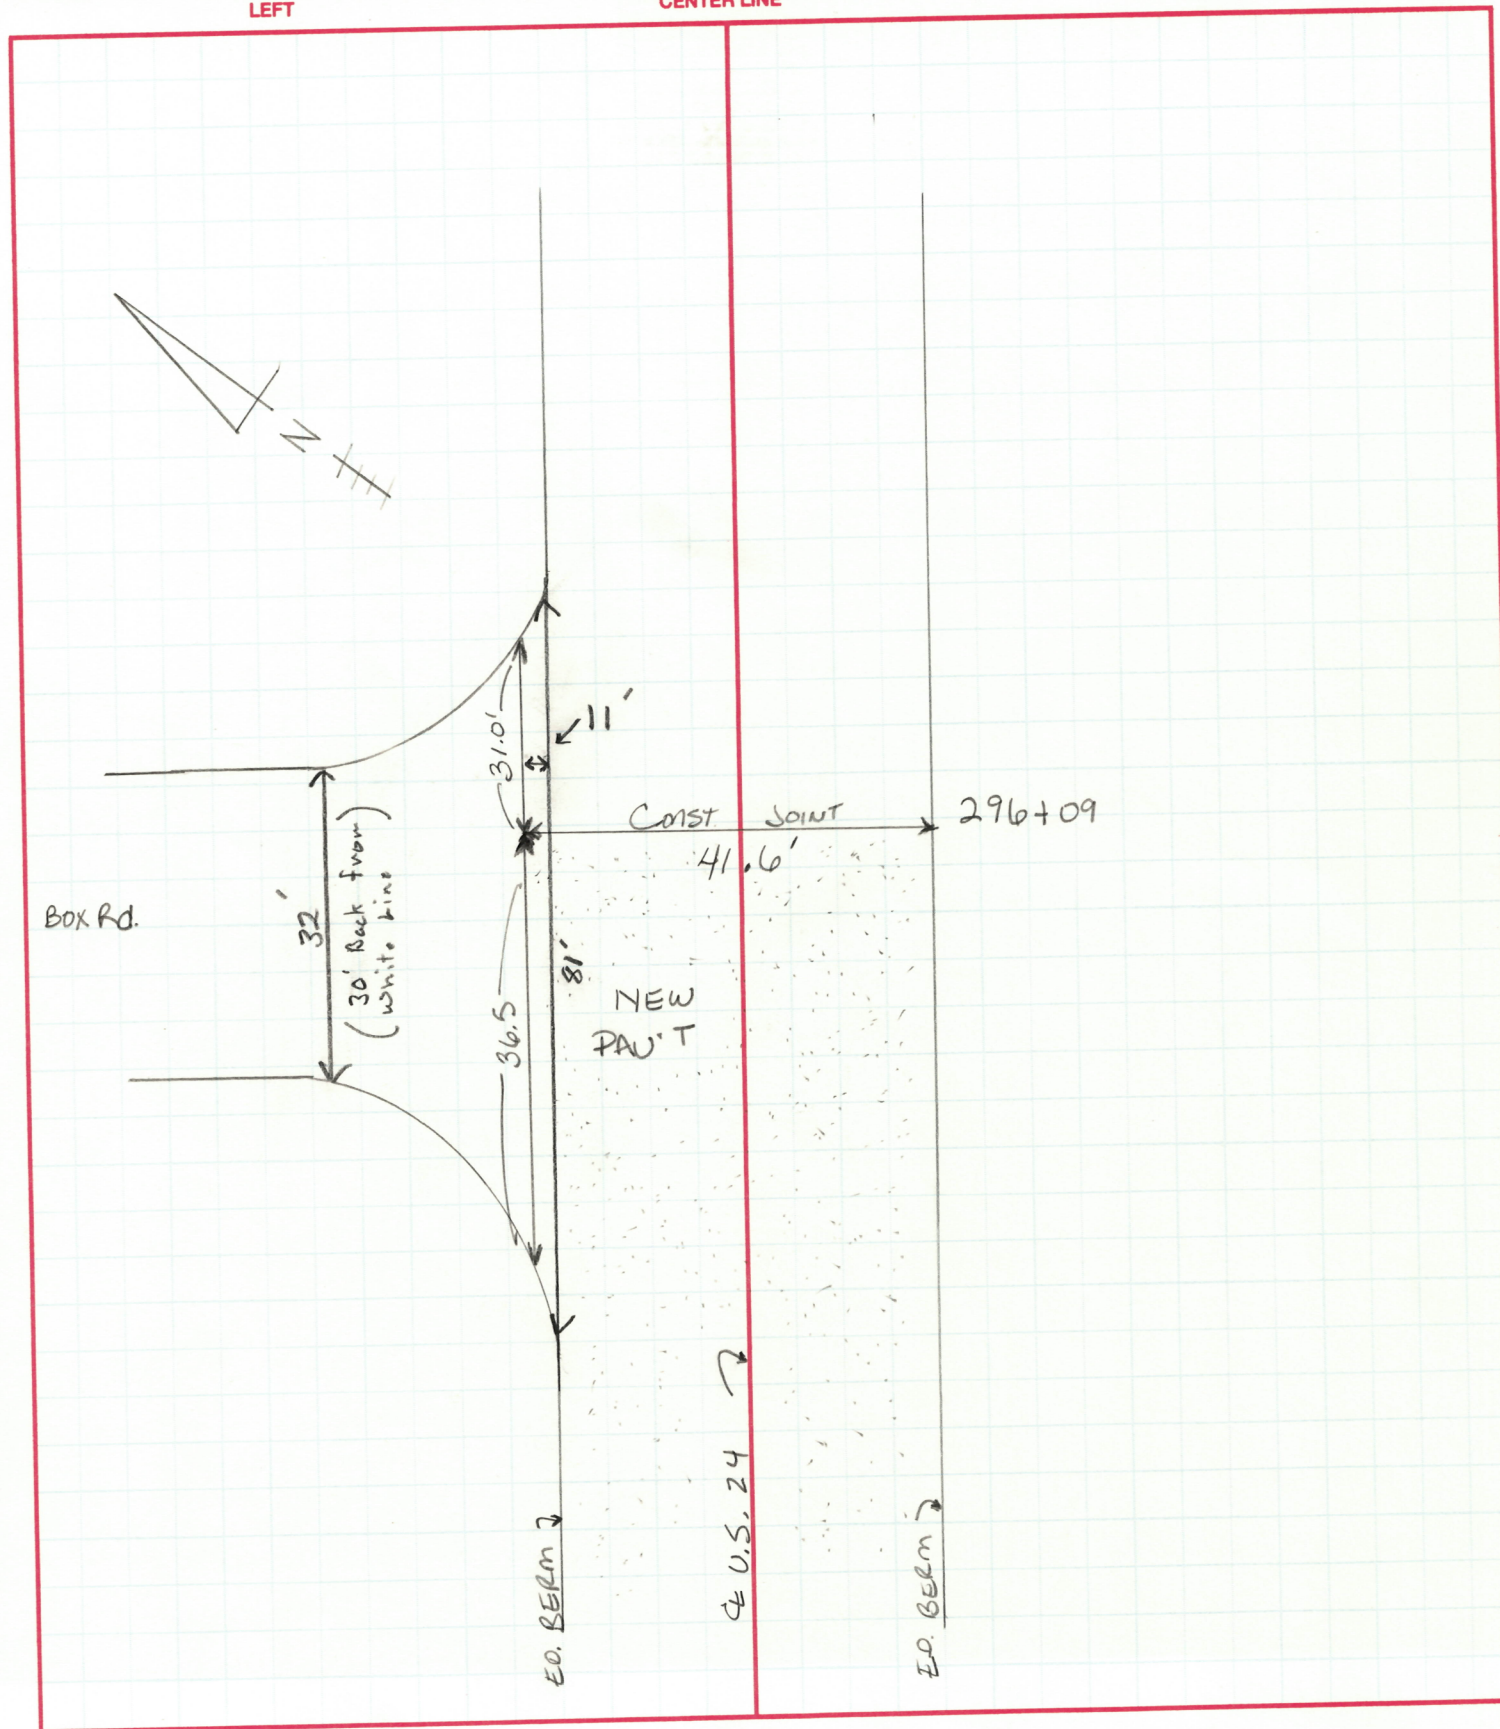


1948WH

OHIO DEPARTMENT OF TRANSPORTATION

SHEET NO. 9 OF 13

PERSONNEL	TITLE	PERSONNEL	TITLE	COUNTY	DATE	WEATHER	TEMP.
VAN DUSEN				LUCAS	11-9-95	CLEAR	+35°F
MOSE				S.R. U.S. 24			
HUSS				SEC. 5.61			

DESCRIPTION	PAVEMENT	DETAIL	JOB NO.
LEFT		CENTER LINE	RIGHT


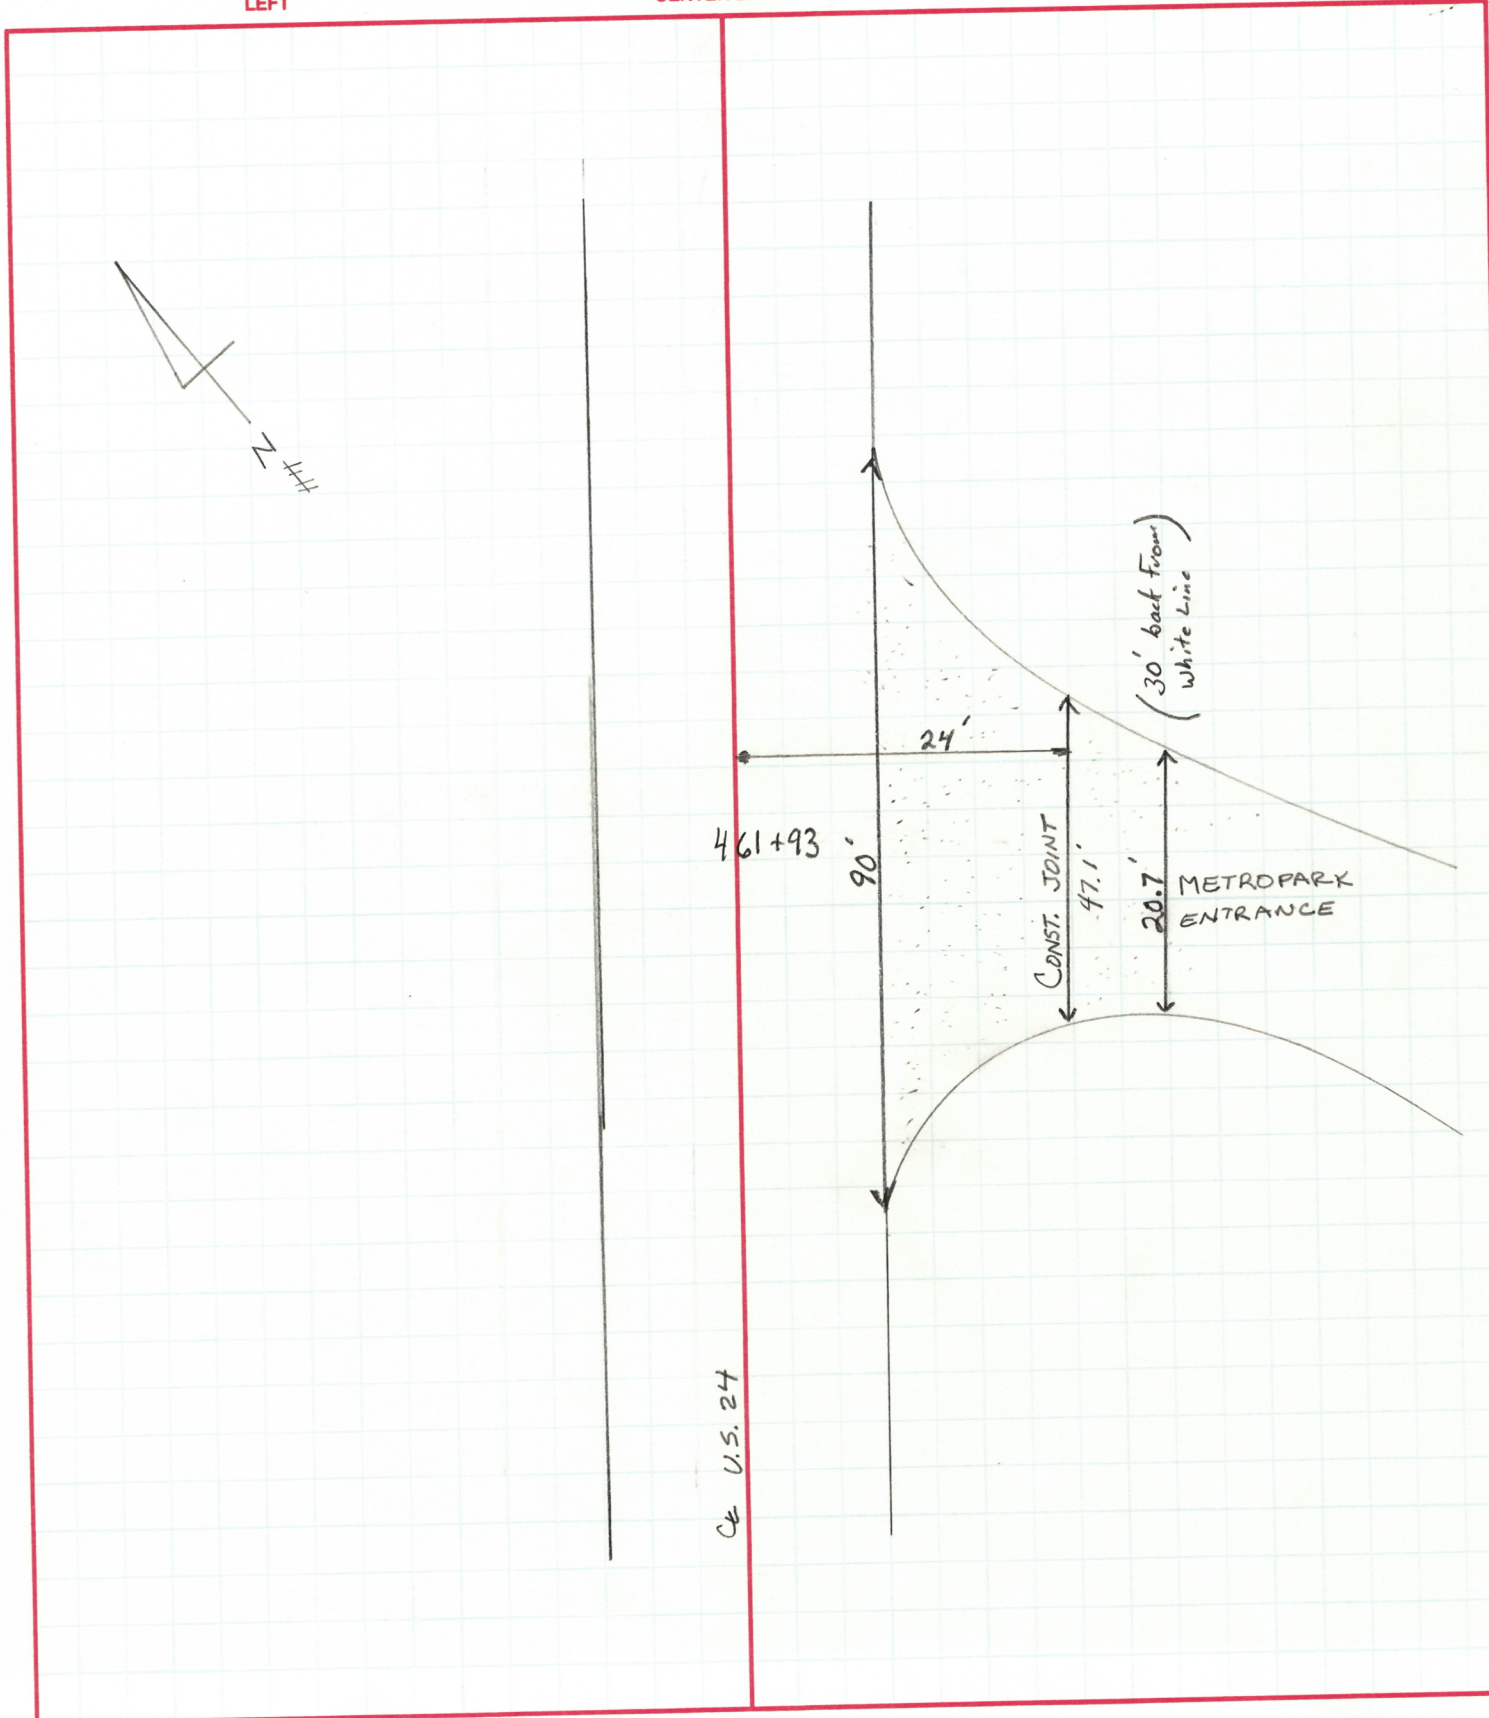


194SWH


OHIO DEPARTMENT OF TRANSPORTATION

SHEET NO. 10 OF 13

PERSONNEL	TITLE	PERSONNEL	TITLE	COUNTY	DATE	WEATHER	TEMP.
VAN DUSEN				LUCAS	11-9-95	CLEAR	+35°F
MOSE				S. R. U.S. 24			
HUSS				SEC. 5.61			
DESCRIPTION PAVEMENT DETAIL				JOB NO.			
LEFT		CENTER LINE		RIGHT			

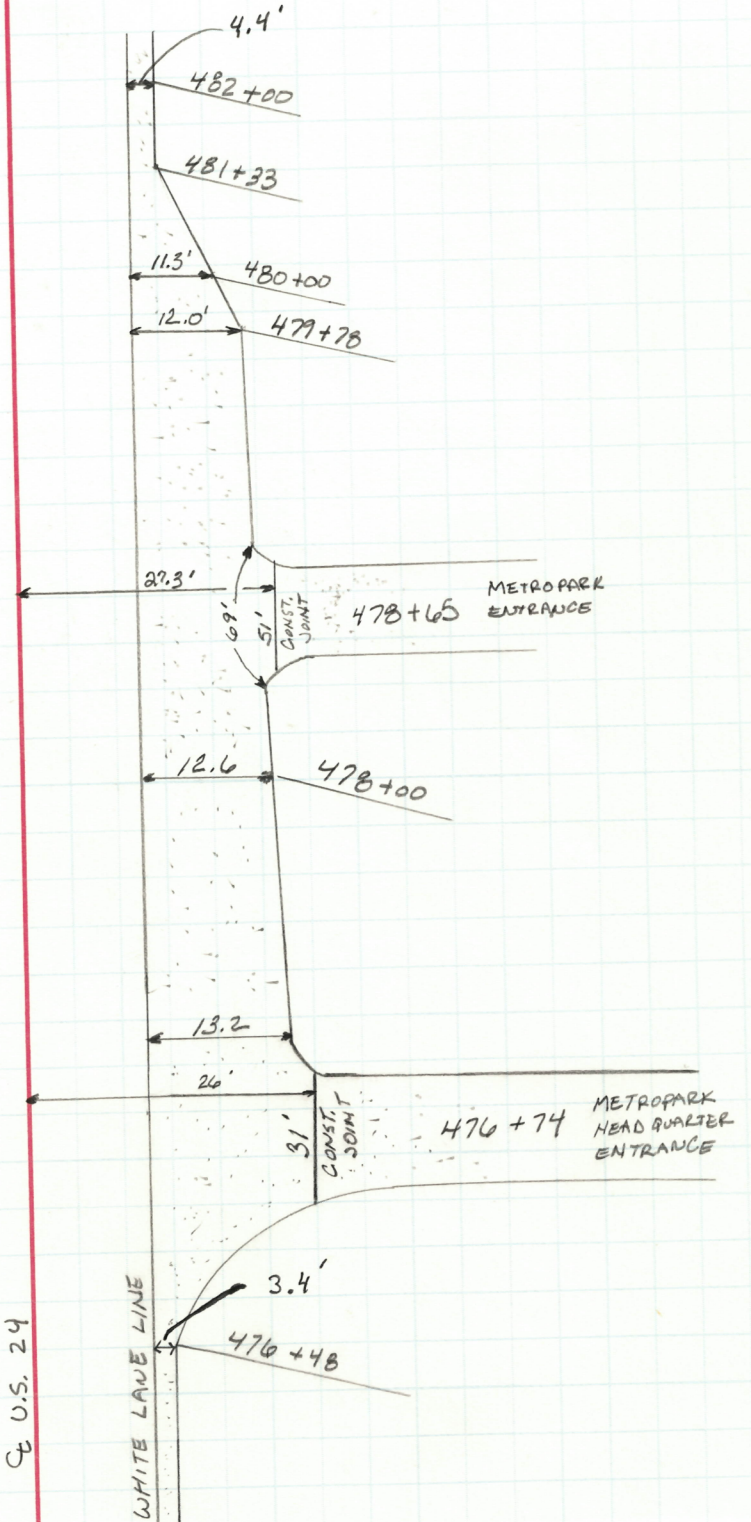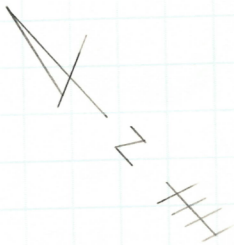

PERSONNEL	TITLE	PERSONNEL	TITLE	COUNTY	DATE	WEATHER	TEMP.
VANDUSEN				LUCAS	11-9-95	CLEAR	+35°F
MOSEK				S. R. U.S. 24			
HUSS				SEC. 5.61			
DESCRIPTION PAVEMENT DETAIL				JOB NO.			
LEFT		CENTER LINE		RIGHT			

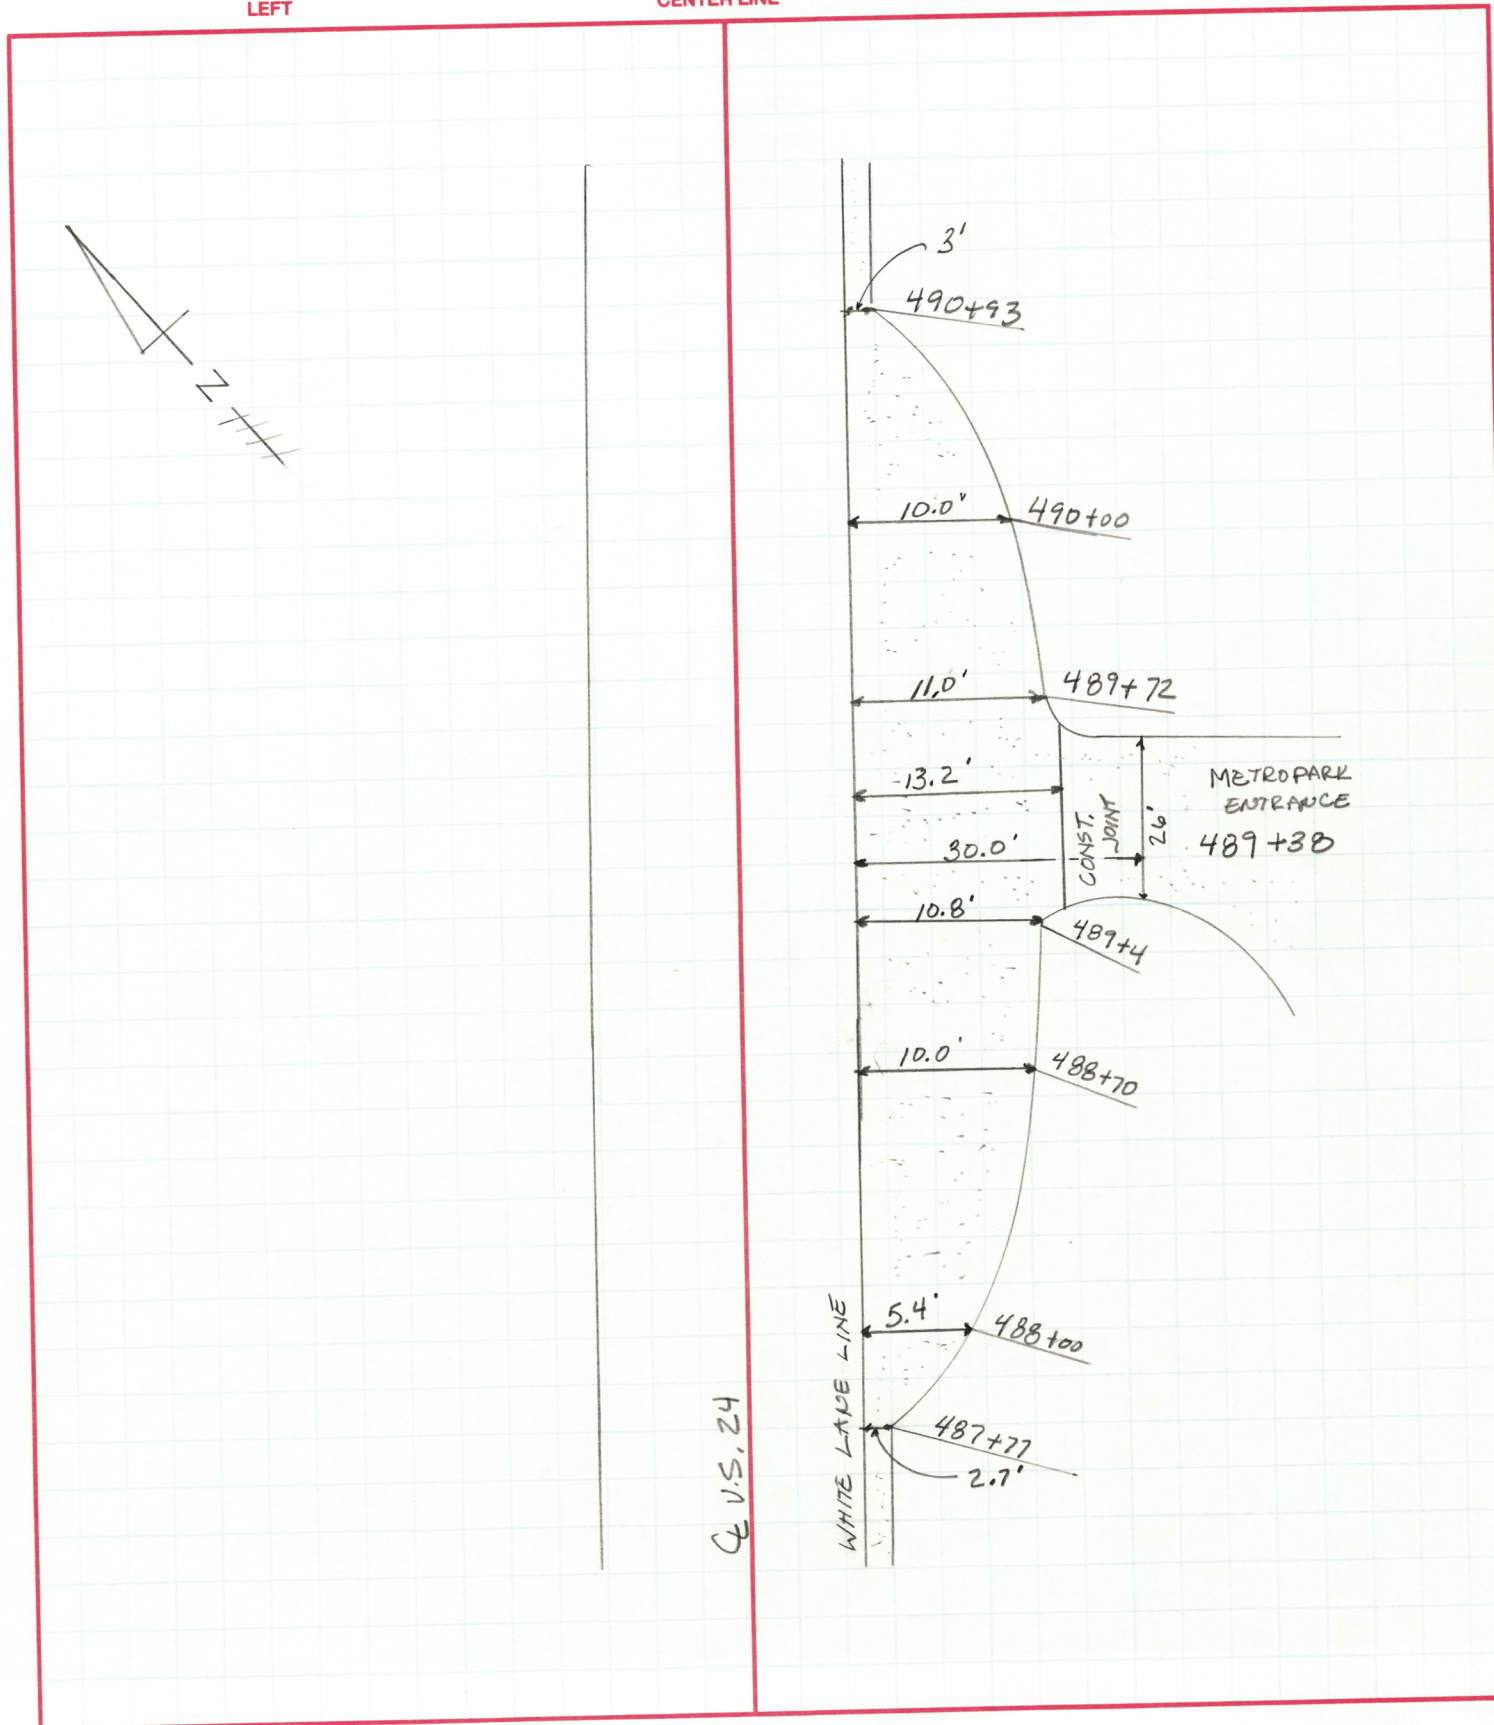


PERSONNEL	TITLE	PERSONNEL	TITLE	COUNTY	DATE	WEATHER	TEMP.
VANDUSEN				LUCAS	11-9-95	CLEAR	+35°F
MOSEY				S. R. U.S. 24			
HUSS				SEC. 5.61			

DESCRIPTION	PAVEMENT DETAIL	JOB NO.
-------------	-----------------	---------


LEFT

CENTER LINE

RIGHT

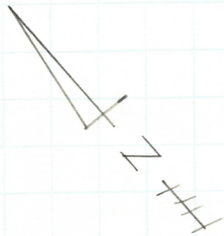

Q. U.S. 24

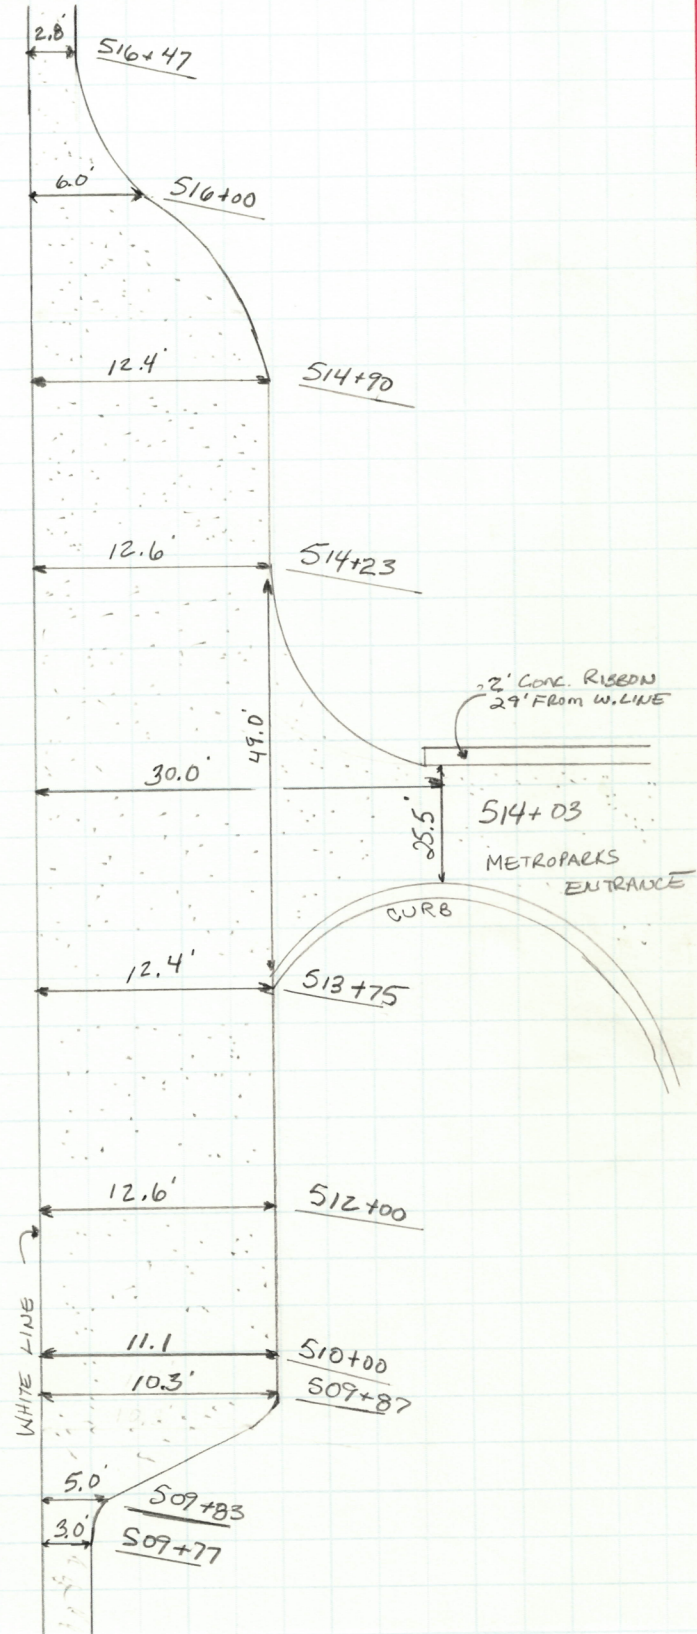

PERSONNEL	TITLE	PERSONNEL	TITLE	COUNTY	DATE
Van Dusen				Lucas	11-09-95
Moser				S. R. US-24	WEATHER Clear
Huss				SEC. 5.61	TEMP. +35° F

DESCRIPTION US-24 + River Rd Intersection JOB NO. _____

LEFT CENTER LINE RIGHT

