



### Defect Listing

<b>Pipe Segment Refere...</b> EAA6C10A08-CSO096A0...	<b>City</b> CLEVELAND	<b>Street</b> E. 26TH ST	<b>Material</b> BRICK	<b>Location C...</b> LIGHT HIGH...	<b>Sewer Use</b> COMBINED
<b>Upstream MH</b> EAA6C10A08	Total Length 120.2	Year Laid	<b>Shape</b> EGG SHAPED	Location Details	
<b>DS Manhole</b> CSO096A0040	Length surveyed 120.2	Year Renewed	<b>Height</b> 76	<b>Width</b> 60	Pipe Joint...

SPR <b>0</b>	MPR <b>48</b>	PO Number		<b>Customer</b> KS ASSOC	
SPRI <b>0</b>	MPRI <b>2</b>	<b>Work Order</b> G		<b>Purpose</b> ROUTINE ASSESSMENT	
QSR <b>0000</b>	QMR <b>2C00</b>	<b>Direction</b> DOWNSTREAM	<b>Date</b> 20200203	<b>Media label</b> 001	
OPR <b>48</b>	<b>Surveyed By</b> Dan_Zaffle	<b>Pre-Cleaning</b> NO PRE-CLEANING	<b>Time</b> 11:55	<b>Weather</b> DRY	
OPRI <b>2</b>	<b>Certificate Number</b> U-804-1527		<b>End Time</b> 12:05	<b>Additional Info</b>	
Date Cleaned					

Distance	Condition	Cont. Dfct.	Values			Joint	Clock Position		Grade
			1st	2nd	%		At/From	To	
0.0 ft.	Access Point Manhole					<input type="checkbox"/>			
<b>Remarks:</b> EAA6C10A08									
0.0 ft.	Water Level				5	<input type="checkbox"/>			
0.0 ft.	Deposits Attached Encrustation	S01			10	<input type="checkbox"/>	7	5	2
0.0 ft.	General Observation					<input type="checkbox"/>			
<b>Remarks:</b> HEAVY STEAM IN LINE									
12.0 ft.	Tap Factory Made Active		24			<input type="checkbox"/>	8		
<b>Remarks:</b> EAA6C10A06									
120.2 ft.	Deposits Attached Encrustation	F01			10	<input type="checkbox"/>	7	5	2
120.2 ft.	Access Point Tee Connection		18			<input type="checkbox"/>	5		
<b>Remarks:</b> CSO096A0040									



### Image Report 4/Page

<b>Pipe Segment Refere...</b> EAA6C10A08-CSO096A0...	<b>City</b> CLEVELAND	<b>Street</b> E. 26TH ST	<b>Material</b> BRICK		<b>Location C...</b> LIGHT HIGH...	<b>Sewer Use</b> COMBINED
<b>Upstream MH</b> EAA6C10A08	Total Length 120.2	Year Laid	<b>Shape</b> EGG SHAPED		Location Details	
<b>DS Manhole</b> CSO096A0040	Length surveyed 120.2	Year Renewed	<b>Height</b> 76	<b>Width</b> 60	Pipe Joint...	




Distance: 0.0 ft.      Grade: 0  
 Condition: Access Point Manhole  
 Remarks: EAA6C10A08



Distance: 0.0 ft.      Grade: 0  
 Condition: Water Level  
 Remarks: N/A



Distance: 0.0 ft.      Grade: 2  
 Condition: Deposits Attached Encrustation  
 Remarks: N/A

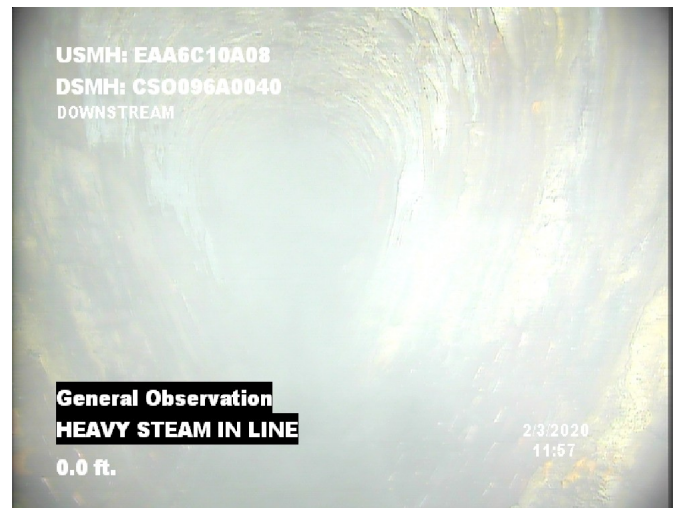

Distance: 0.0 ft.      Grade: 0  
 Condition: General Observation  
 Remarks: HEAVY STEAM IN LINE




### Image Report 4/Page

<b>Pipe Segment Refere...</b> EAA6C10A08-CSO096A0...	<b>City</b> CLEVELAND	<b>Street</b> E. 26TH ST	<b>Material</b> BRICK	<b>Location C...</b> LIGHT HIGH...	<b>Sewer Use</b> COMBINED
<b>Upstream MH</b> EAA6C10A08	Total Length 120.2	Year Laid	<b>Shape</b> EGG SHAPED	Location Details	
<b>DS Manhole</b> CSO096A0040	Length surveyed 120.2	Year Renewed	<b>Height</b> 76	<b>Width</b> 60	Pipe Joint...



Distance: 12.0 ft.      Grade: 0  
 Condition: Tap Factory Made Active  
 Remarks: EAA6C10A06

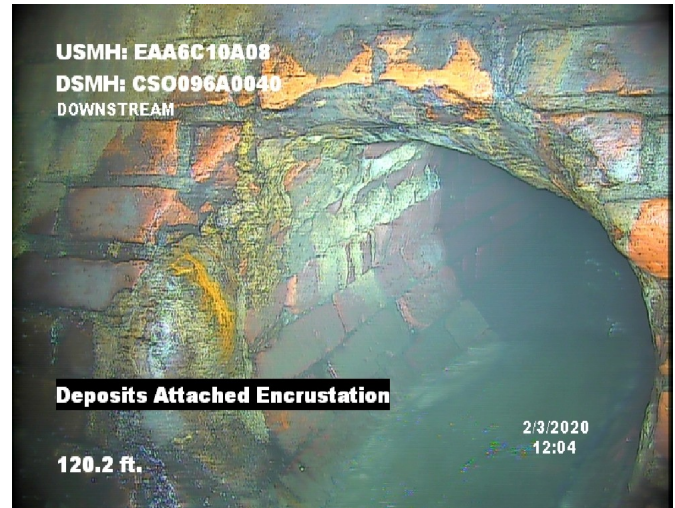

Distance: 120.2 ft.      Grade: 2  
 Condition: Deposits Attached Encrustation  
 Remarks: N/A



Distance: 120.2 ft.      Grade: 0  
 Condition: Access Point Tee Connection  
 Remarks: CSO096A0040