



Defect Listing

Pipe Segment Refere... CSO200A0010-CSO200A...	City CLEVELAND	Street E 40TH ST	Material BRICK	Location C... MAIN HIGHW...	Sewer Use COMBINED
Upstream MH CSO200A0010	Total Length 62.9	Year Laid	Shape CIRCULAR	Location Details	
DS Manhole CSO200A0009	Length surveyed 62.9	Year Renewed	Height 60	Width 60	Pipe Joint...

SPR 0	MPR 48	PO Number		Customer KS ASSOC	
SPRI 0	MPRI 3	Work Order		Purpose ROUTINE ASSESSMENT	
QSR 0000	QMR 413A	G			
OPR 48	Surveyed By Dan_Zaffle	Direction DOWNSTREAM	Date 20200205	Media label 001	
OPRI 3	Certificate Number U-804-1527	Pre-Cleaning NO PRE-CLEANING	Time 12:37	Weather DRY	
Date Cleaned			End Time 12:51	Additional Info	

Distance	Condition	Cont. Dfct.	Values			Joint	Clock Position		Grade
			1st	2nd	%		At/From	To	
0.0 ft.	Access Point Manhole					<input type="checkbox"/>			
Remarks: CSO200A0010									
0.0 ft.	Water Level				0	<input type="checkbox"/>			
0.0 ft.	Deposits Settled Fine	S01			20	<input type="checkbox"/>	5	7	3
18.8 ft.	Obstacle Built Into Structure				10	<input type="checkbox"/>	6		2
Remarks: CHANNEL									
32.4 ft.	Deposits Attached Encrustation				20	<input type="checkbox"/>	4	9	3
42.9 ft.	General Observation					<input type="checkbox"/>			
Remarks: 100% BLOCKED									
42.9 ft.	Alignment Left				100	<input type="checkbox"/>			4
62.9 ft.	Deposits Settled Fine	F01			20	<input type="checkbox"/>	5	7	3
62.9 ft.	Access Point Manhole					<input type="checkbox"/>			
Remarks: CSO200A0009									



Image Report 4/Page

Pipe Segment Refere... CSO200A0010-CSO200A...	City CLEVELAND	Street E 40TH ST	Material BRICK		Location C... MAIN HIGHW..	Sewer Use COMBINED
Upstream MH CSO200A0010	Total Length 62.9	Year Laid	Shape CIRCULAR		Location Details	
DS Manhole CSO200A0009	Length surveyed 62.9	Year Renewed	Height 60	Width 60	Pipe Joint...	



Distance: 0.0 ft. **Grade:** 0
Condition: Access Point Manhole
Remarks: CSO200A0010



Distance: 0.0 ft. **Grade:** 0
Condition: Water Level
Remarks: N/A



Distance: 0.0 ft. **Grade:** 3
Condition: Deposits Settled Fine
Remarks: N/A




Distance: 18.8 ft. **Grade:** 2
Condition: Obstacle Built Into Structure
Remarks: CHANNEL



Image Report 4/Page

Pipe Segment Refere...	City	Street	Material	Location C...	Sewer Use
CSO200A0010-CSO200A...	CLEVELAND	E 40TH ST	BRICK	MAIN HIGHW..	COMBINED
Upstream MH	Total Length	Year Laid	Shape	Location Details	
CSO200A0010	62.9		CIRCULAR		
DS Manhole	Length surveyed	Year Renewed	Height	Width	Pipe Joint...
CSO200A0009	62.9		60	60	

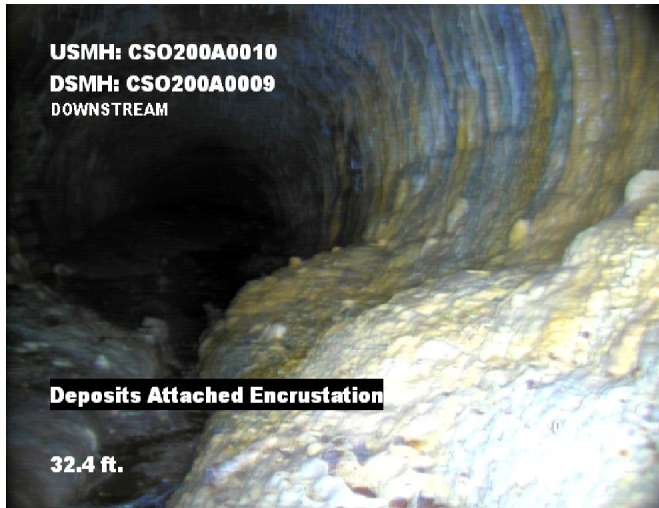

Distance: 32.4 ft. Grade: 3
 Condition: Deposits Attached Encrustation
 Remarks: N/A



Distance: 42.9 ft. Grade: 0
 Condition: General Observation
 Remarks: 100% BLOCKED



Distance: 42.9 ft. Grade: 4
 Condition: Alignment Left
 Remarks: N/A




Distance: 62.9 ft. Grade: 3
 Condition: Deposits Settled Fine
 Remarks: N/A



Image Report 4/Page

Pipe Segment Refere... CSO200A0010-CSO200A...	City CLEVELAND	Street E 40TH ST	Material BRICK		Location C... MAIN HIGHW..	Sewer Use COMBINED
Upstream MH CSO200A0010	Total Length 62.9	Year Laid	Shape CIRCULAR		Location Details	
DS Manhole CSO200A0009	Length surveyed 62.9	Year Renewed	Height 60	Width 60	Pipe Joint...	

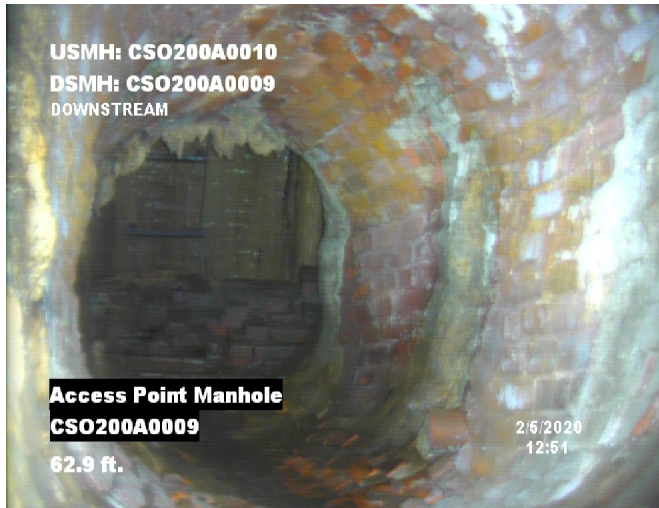

Distance:	62.9 ft.	Grade:	0
Condition:	Access Point Manhole		
Remarks:	CSO200A0009		