


CONSOLIDATION TEST REPORT

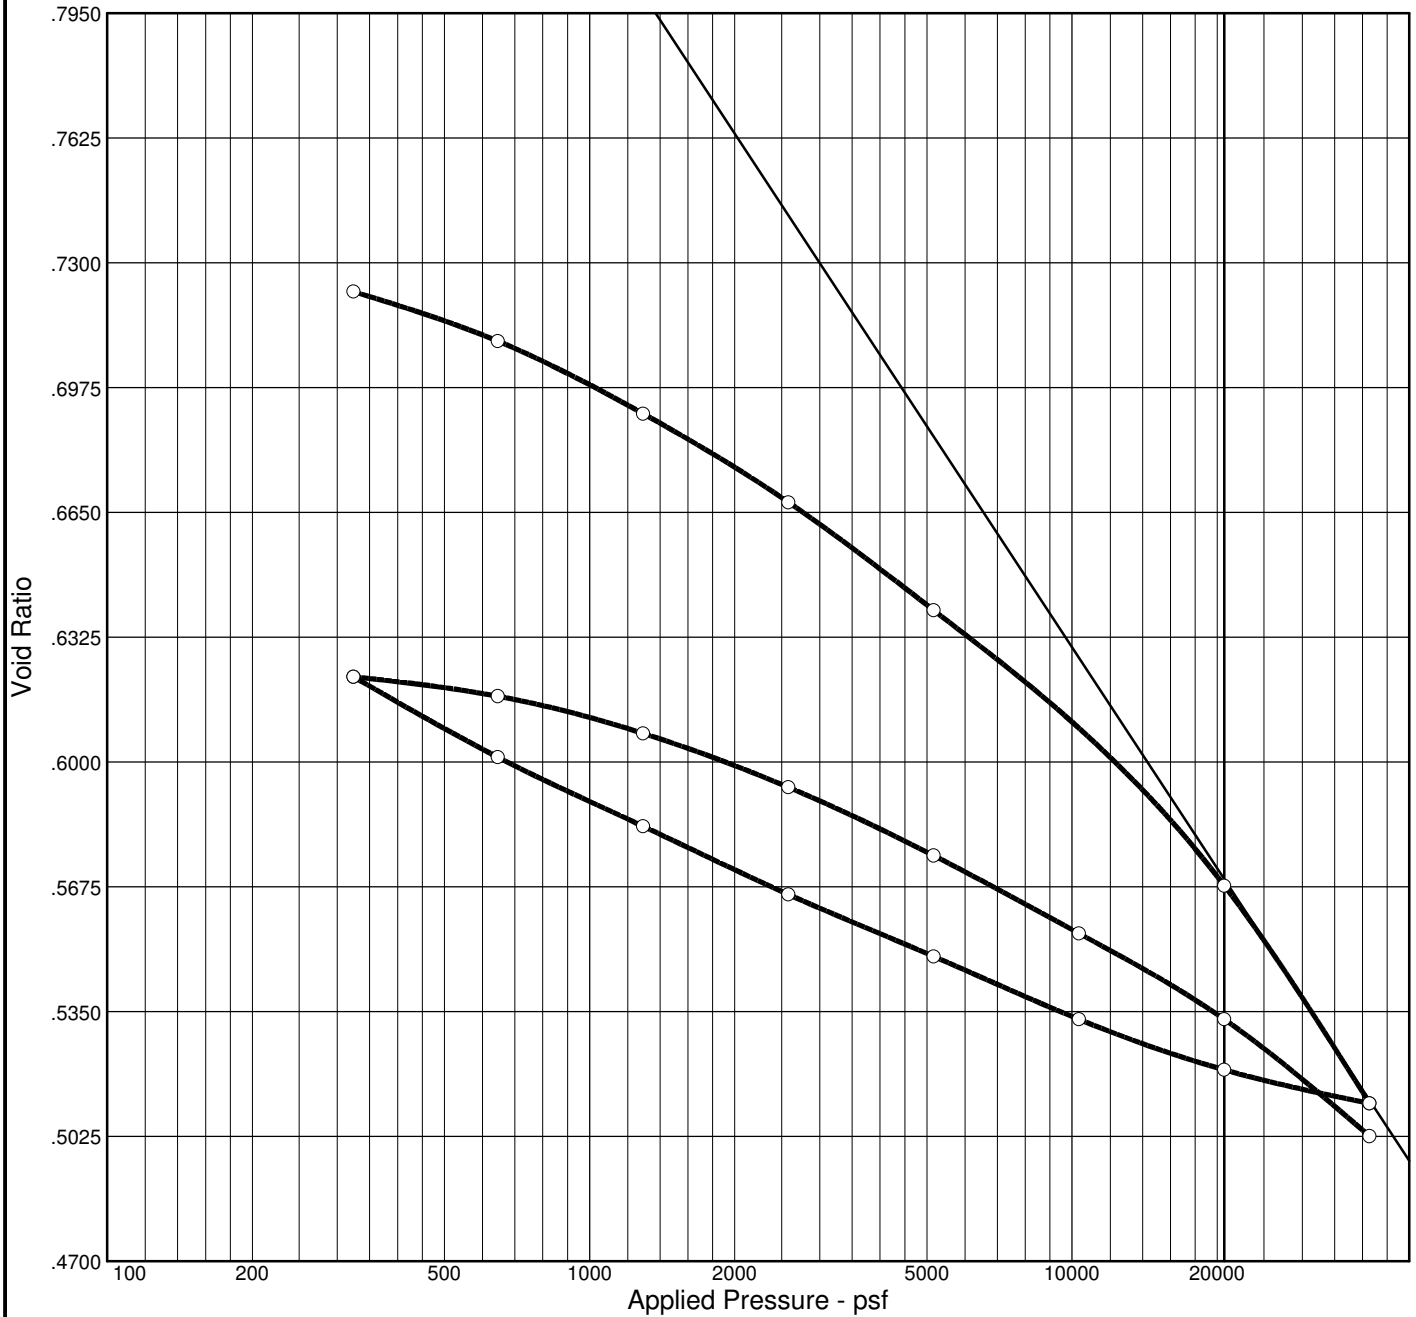

Natural		Dry Dens. (pcf)	LL	PI	Sp. Gr.	USCS	AASHTO	Initial Void Ratio
Saturation	Moisture							
98.7 %	25.9 %	100.4	42	19	2.78	CL	A-7-6(21)	0.729

MATERIAL DESCRIPTION

Lean clay

Project No. 0121-
Project: SCI-823-0.00

Client: TranSystems, Inc.

Remarks:

Source: C-91

Sample No.: P1

Elev./Depth: 10.0



Figure

Dial Reading vs. Time





Project No.: 0121-3070.03

Project: SCI-823-0.00

Source: C-91

Sample No.: P1

Elev./Depth: 10.0

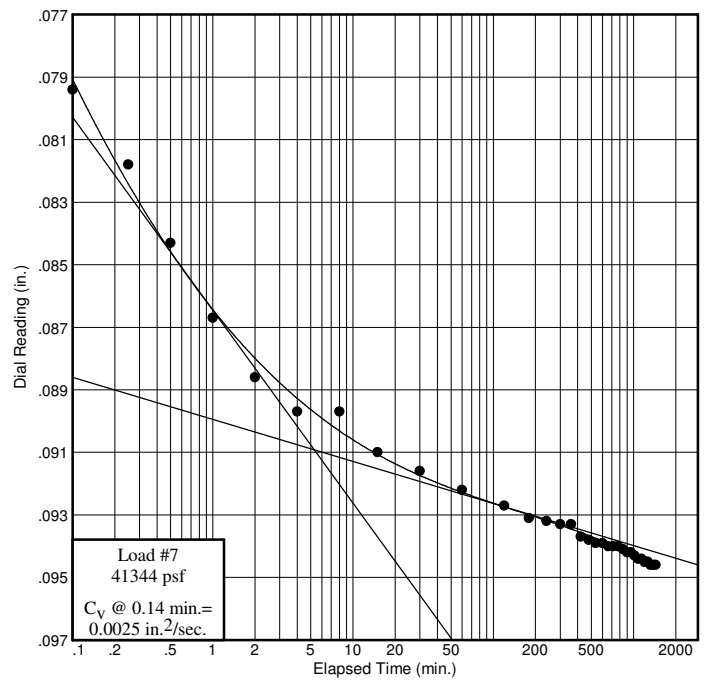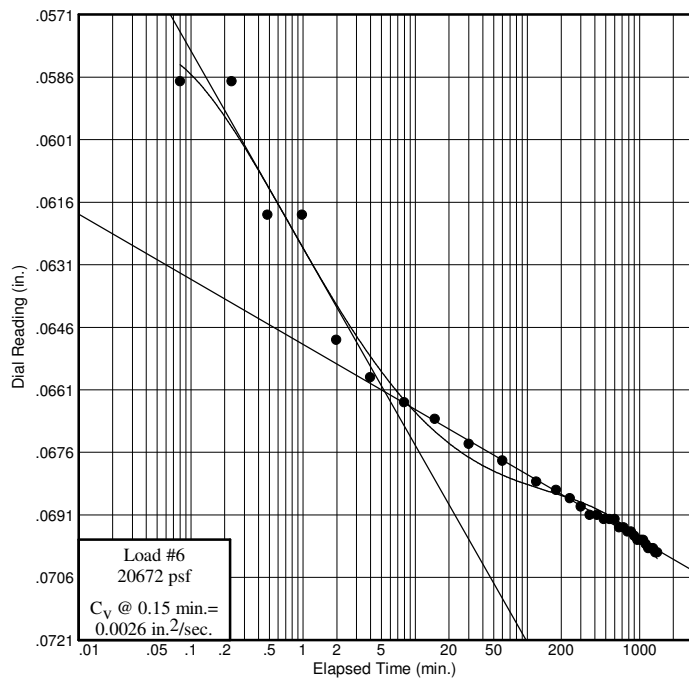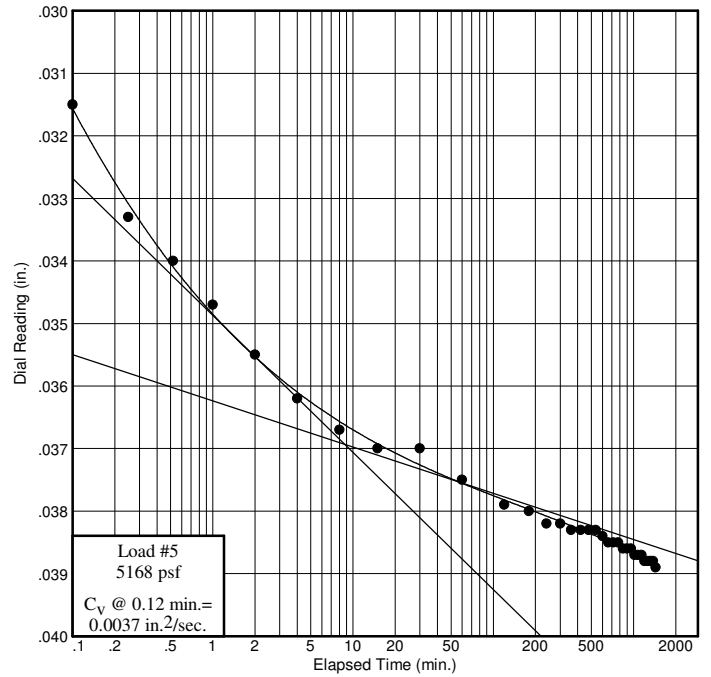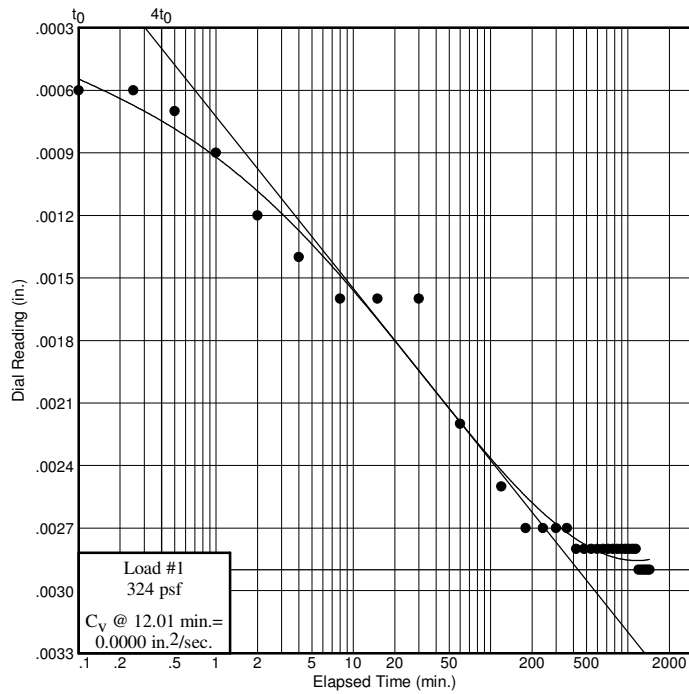

Figure

Dial Reading vs. Time





Project No.: 0121-3070.03

Project: SCI-823-0.00

Source: C-91

Sample No.: P1

Elev./Depth: 10.0

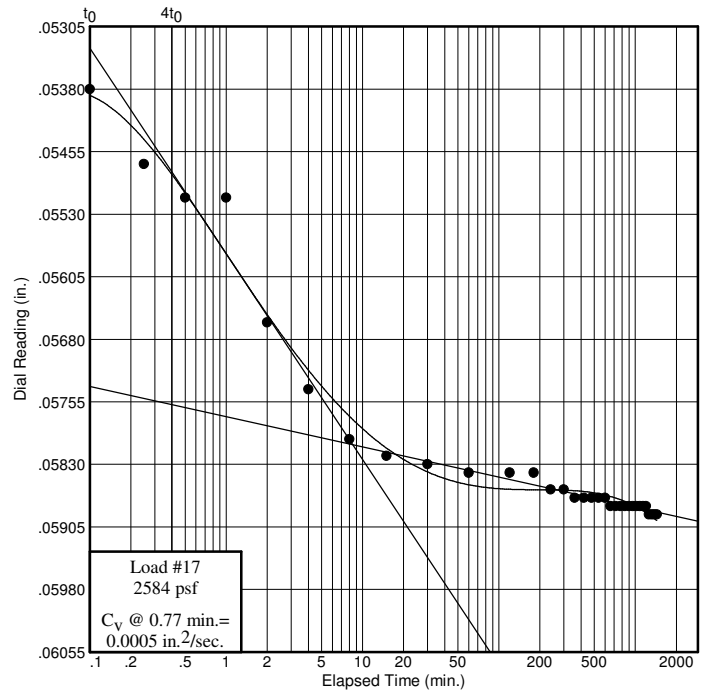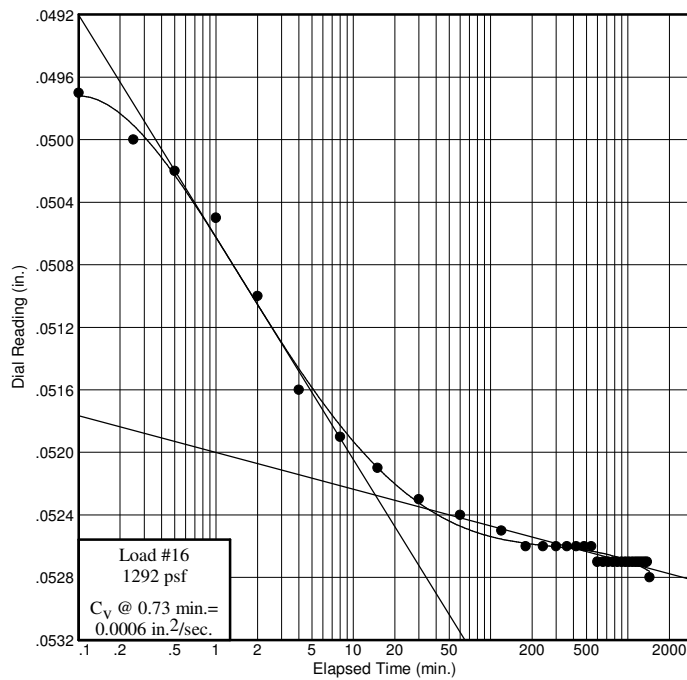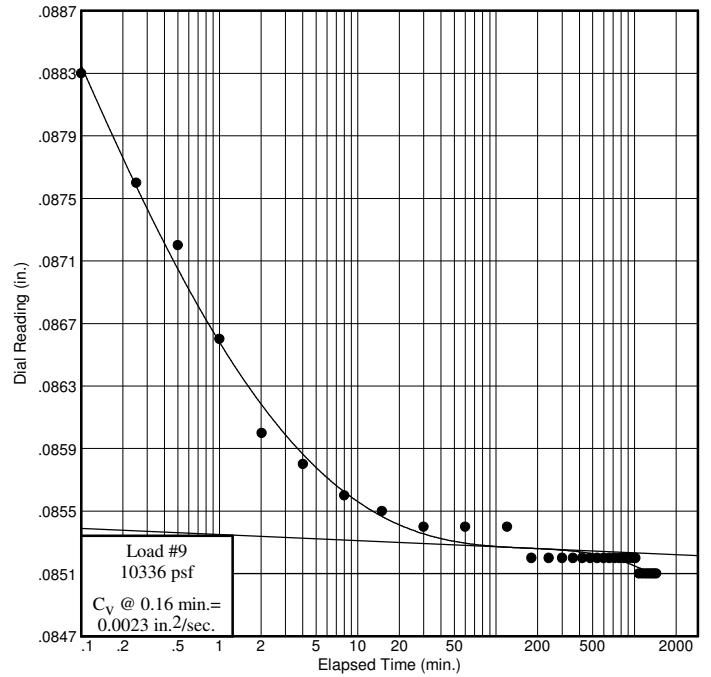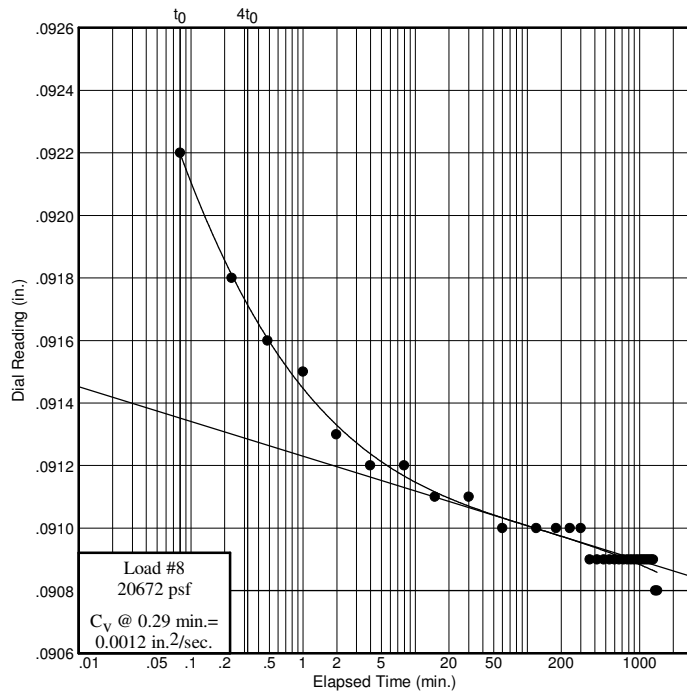

Figure

Dial Reading vs. Time





Project No.: 0121-3070.03

Project: SCI-823-0.00

Source: C-91


Sample No.: P1

Elev./Depth: 10.0

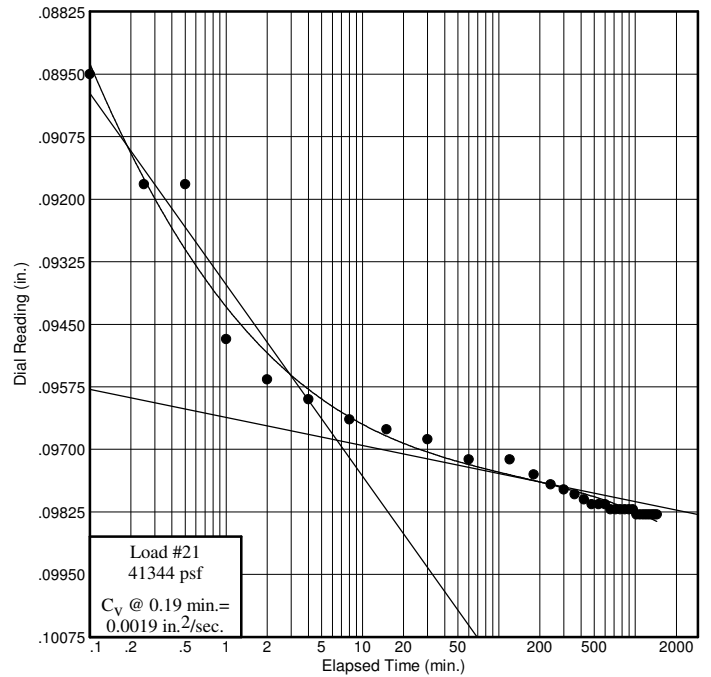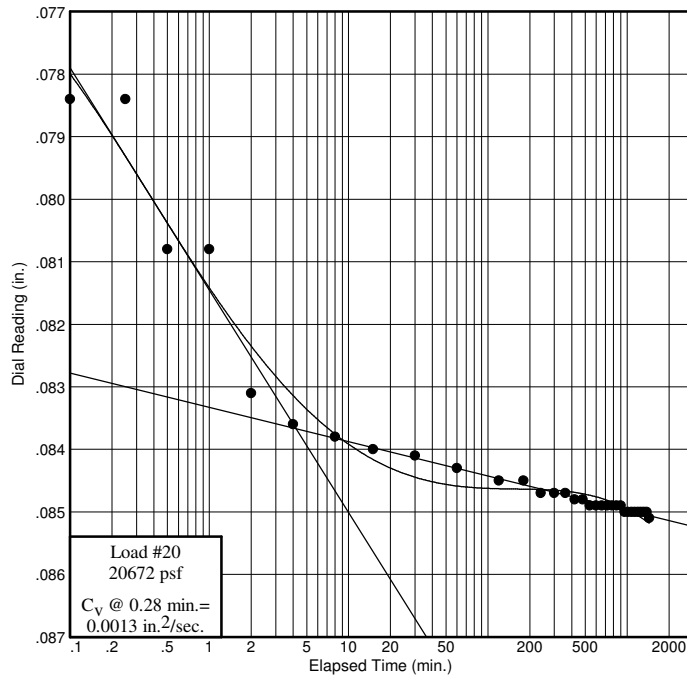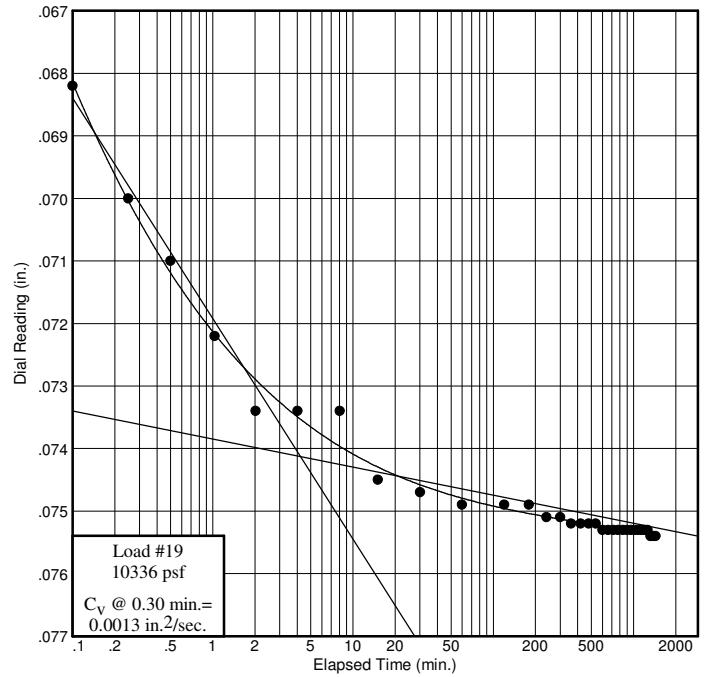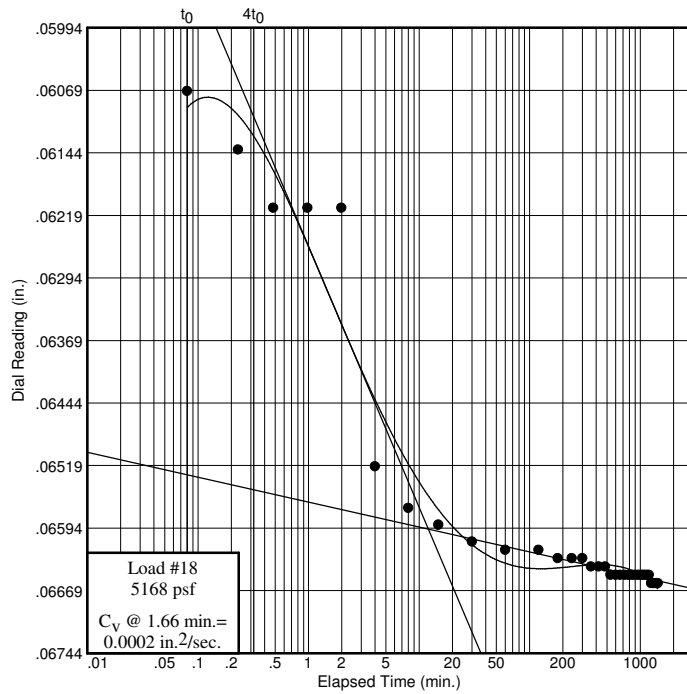

Figure

CONSOLIDATION TEST REPORT

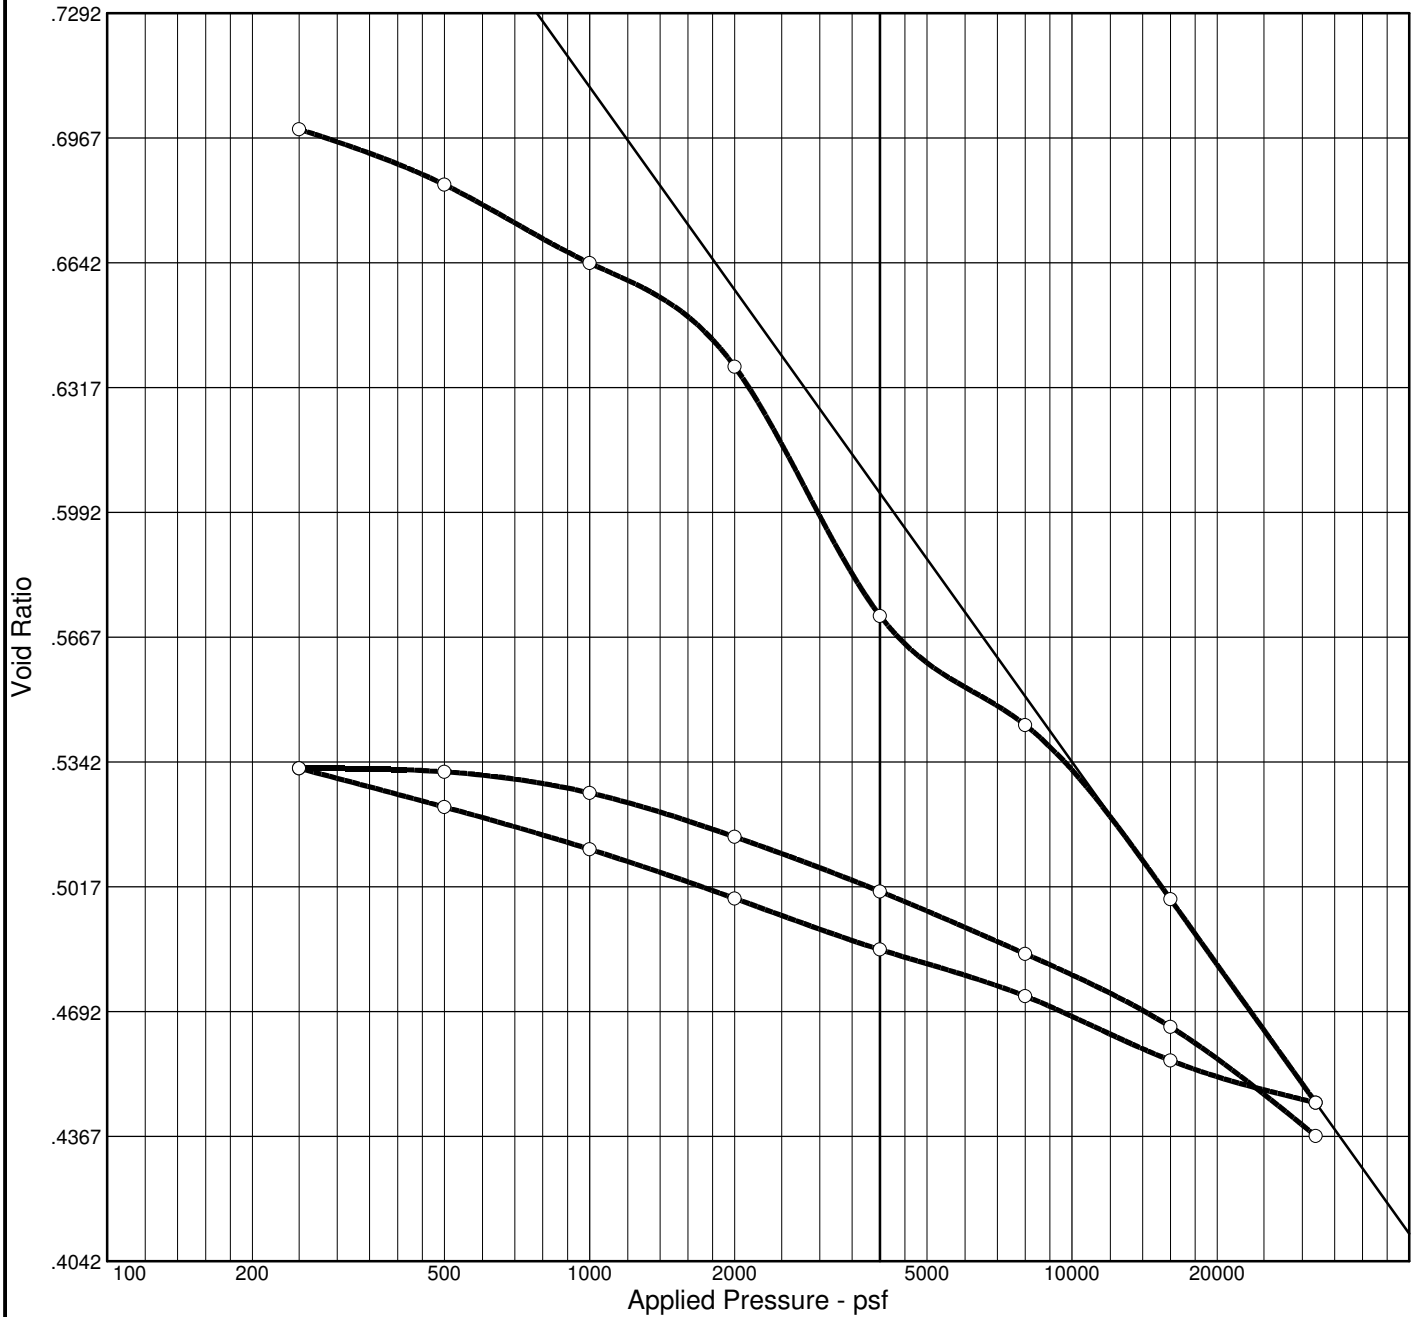

Natural		Dry Dens. (pcf)	LL	PI	Sp. Gr.	USCS	AASHTO	Initial Void Ratio
Saturation	Moisture							
94.9 %	24.5 %	101.0	38	16	2.78	CL	A-6(17)	0.719

MATERIAL DESCRIPTION

Lean clay

Project No. 0121-
Project: SCI-823-0.00

Client: TranSystems, Inc.

Remarks:

Source: C-91

Sample No.: P2

Elev./Depth: 26.0



Figure

Dial Reading vs. Time





Project No.: 0121-3070.03

Project: SCI-823-0.00

Source: C-91

Sample No.: P2

Elev./Depth: 26.0

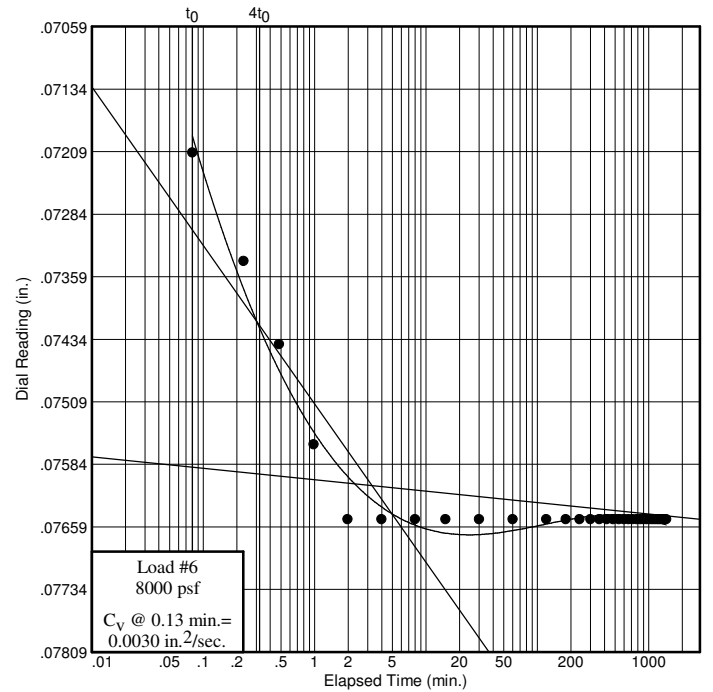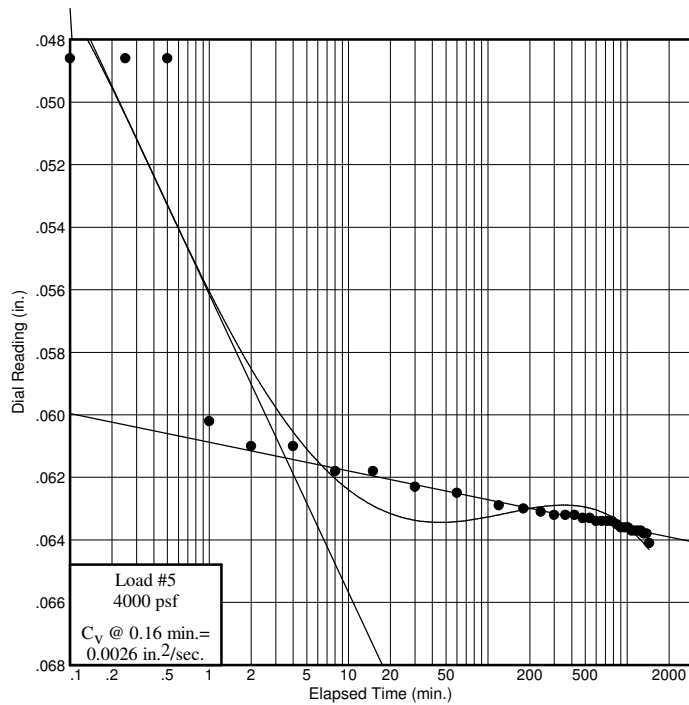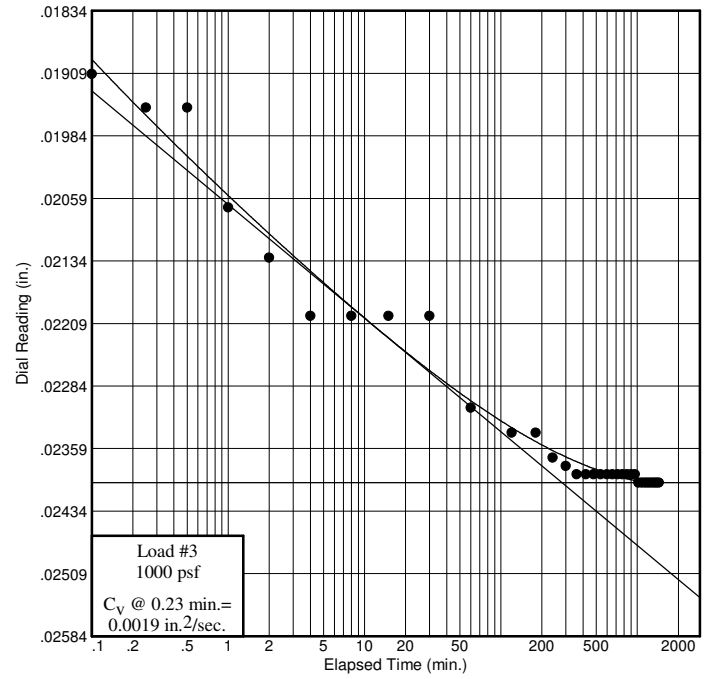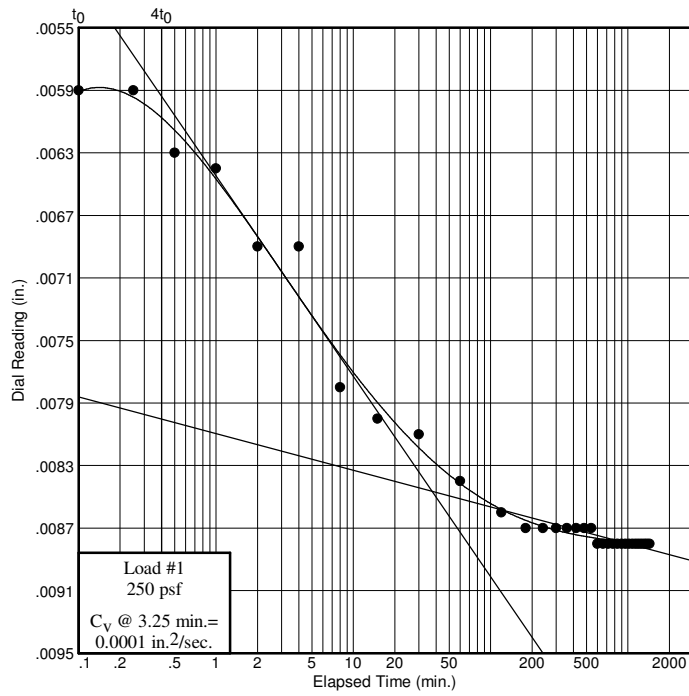

Figure

Dial Reading vs. Time





Project No.: 0121-3070.03

Project: SCI-823-0.00

Source: C-91

Sample No.: P2

Elev./Depth: 26.0

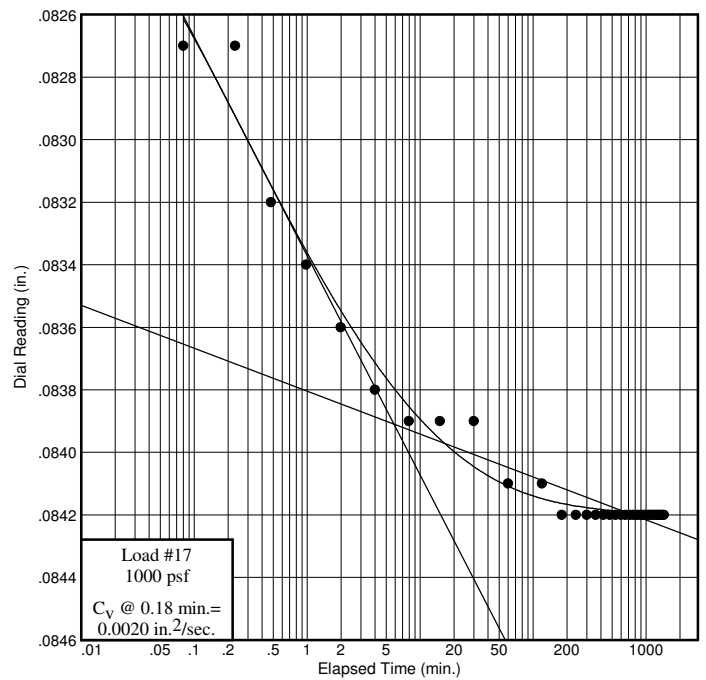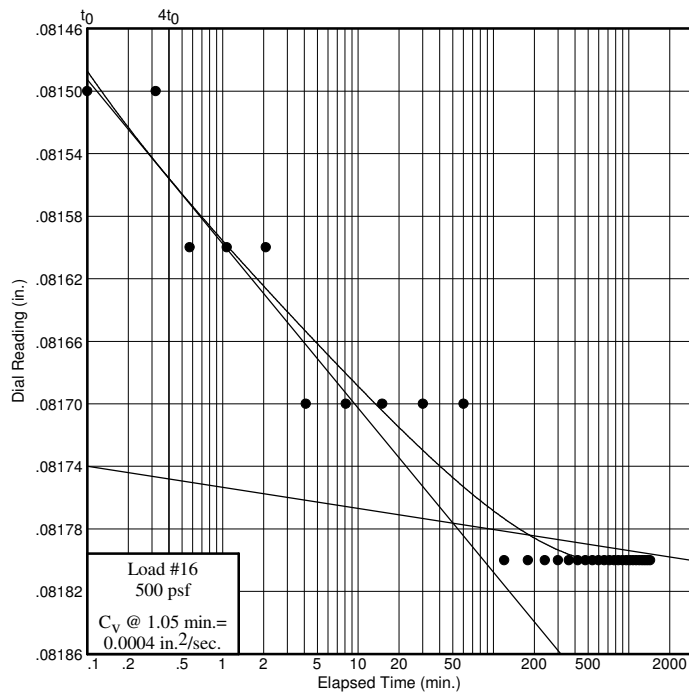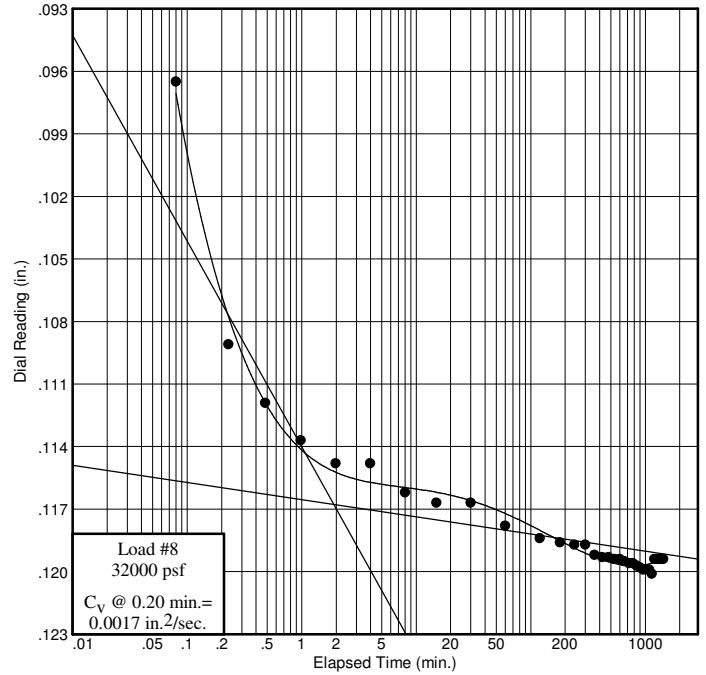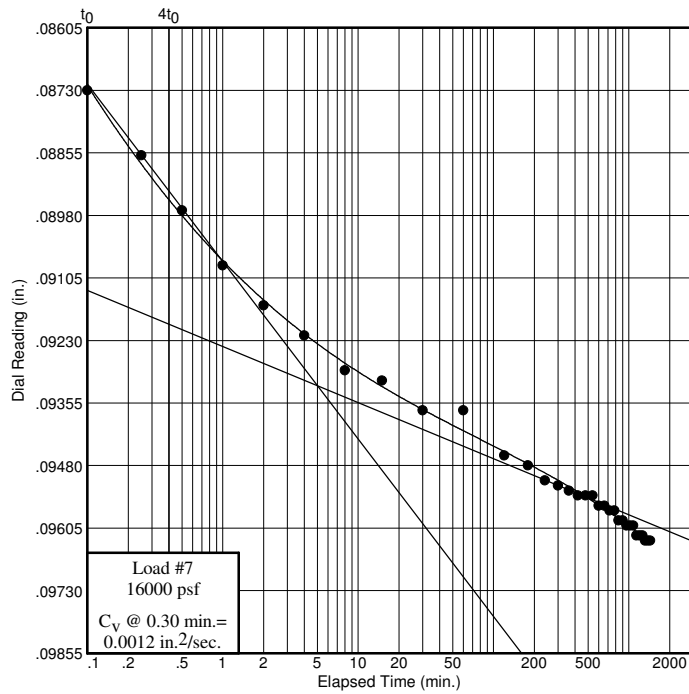

Figure

Dial Reading vs. Time





Project No.: 0121-3070.03

Project: SCI-823-0.00

Source: C-91

Sample No.: P2

Elev./Depth: 26.0

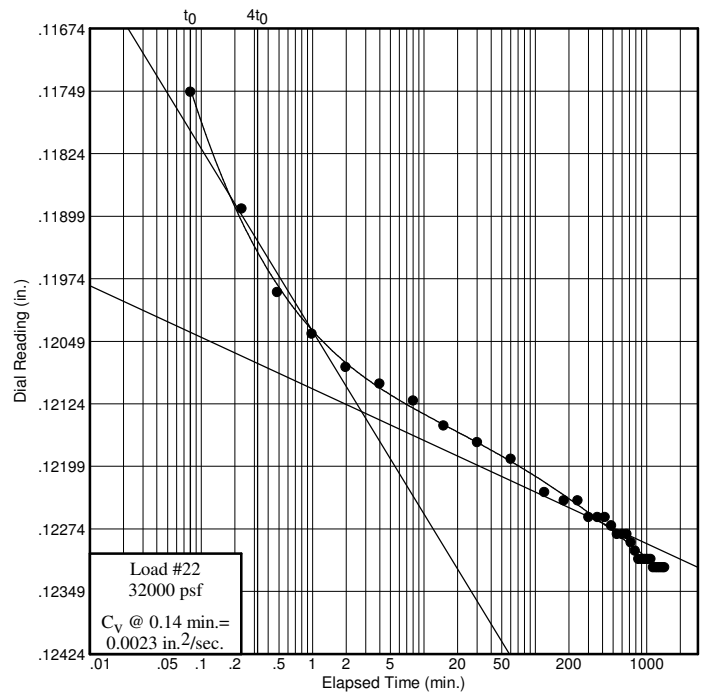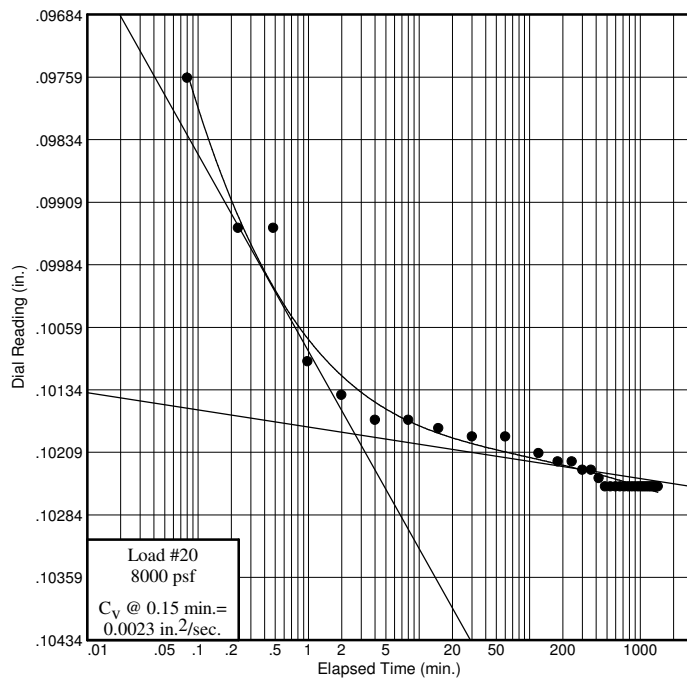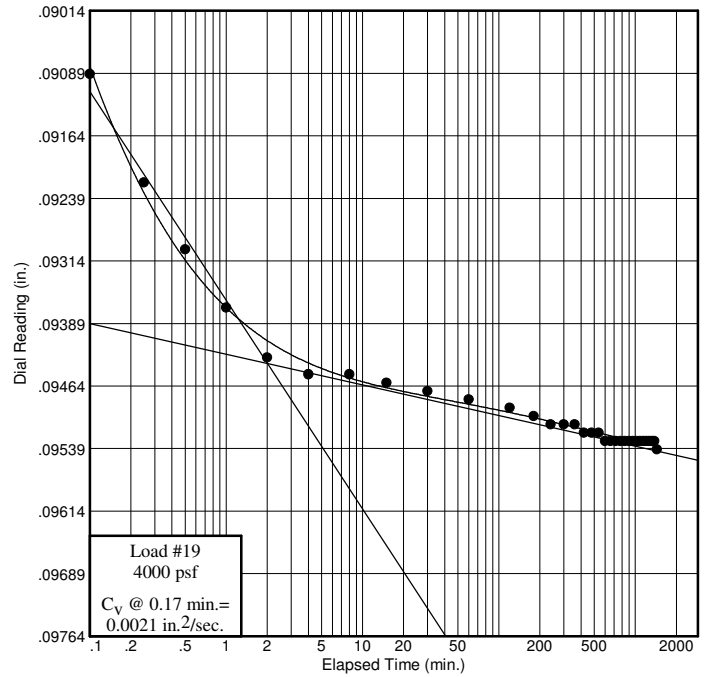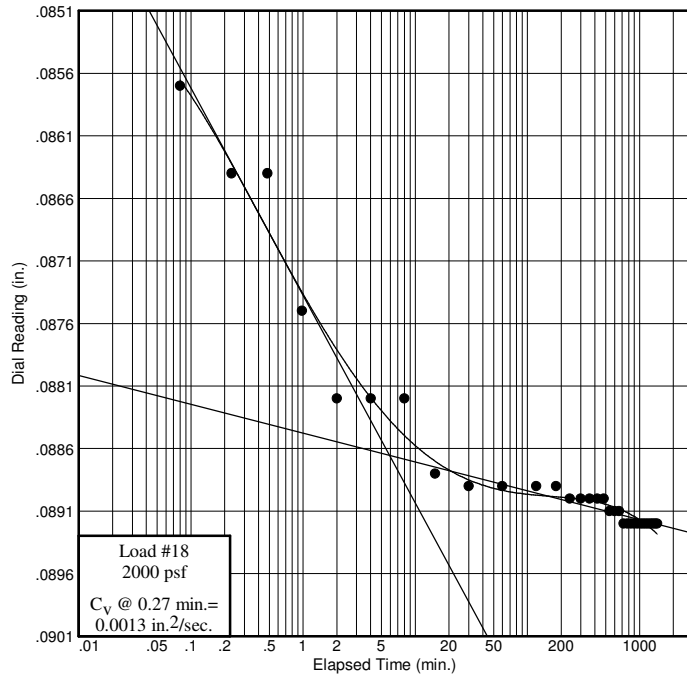

Figure